




ONE - BRACE - 127VR1

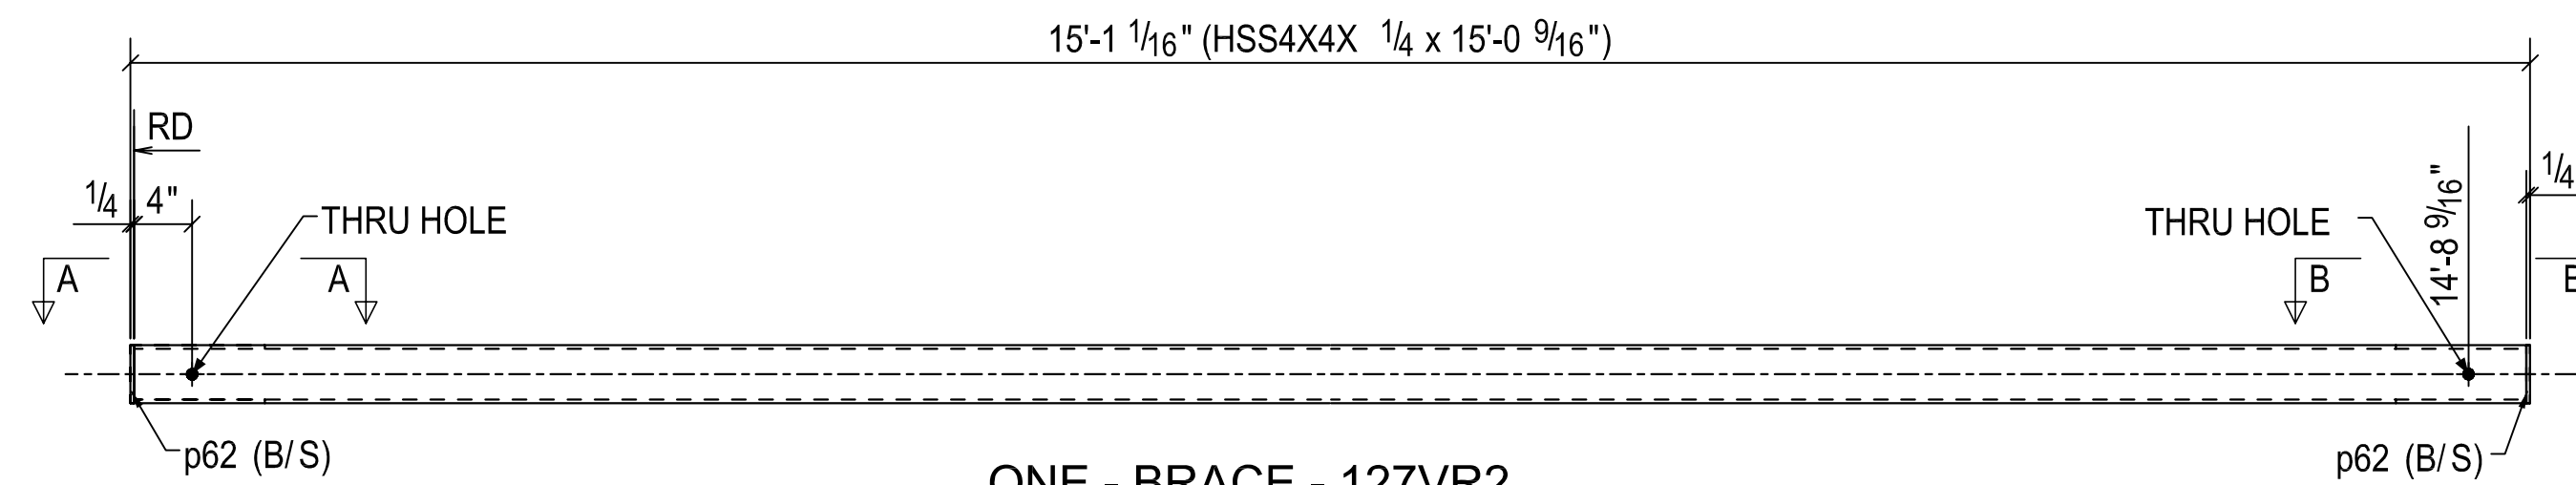


ONE - BRACE - 127VR2

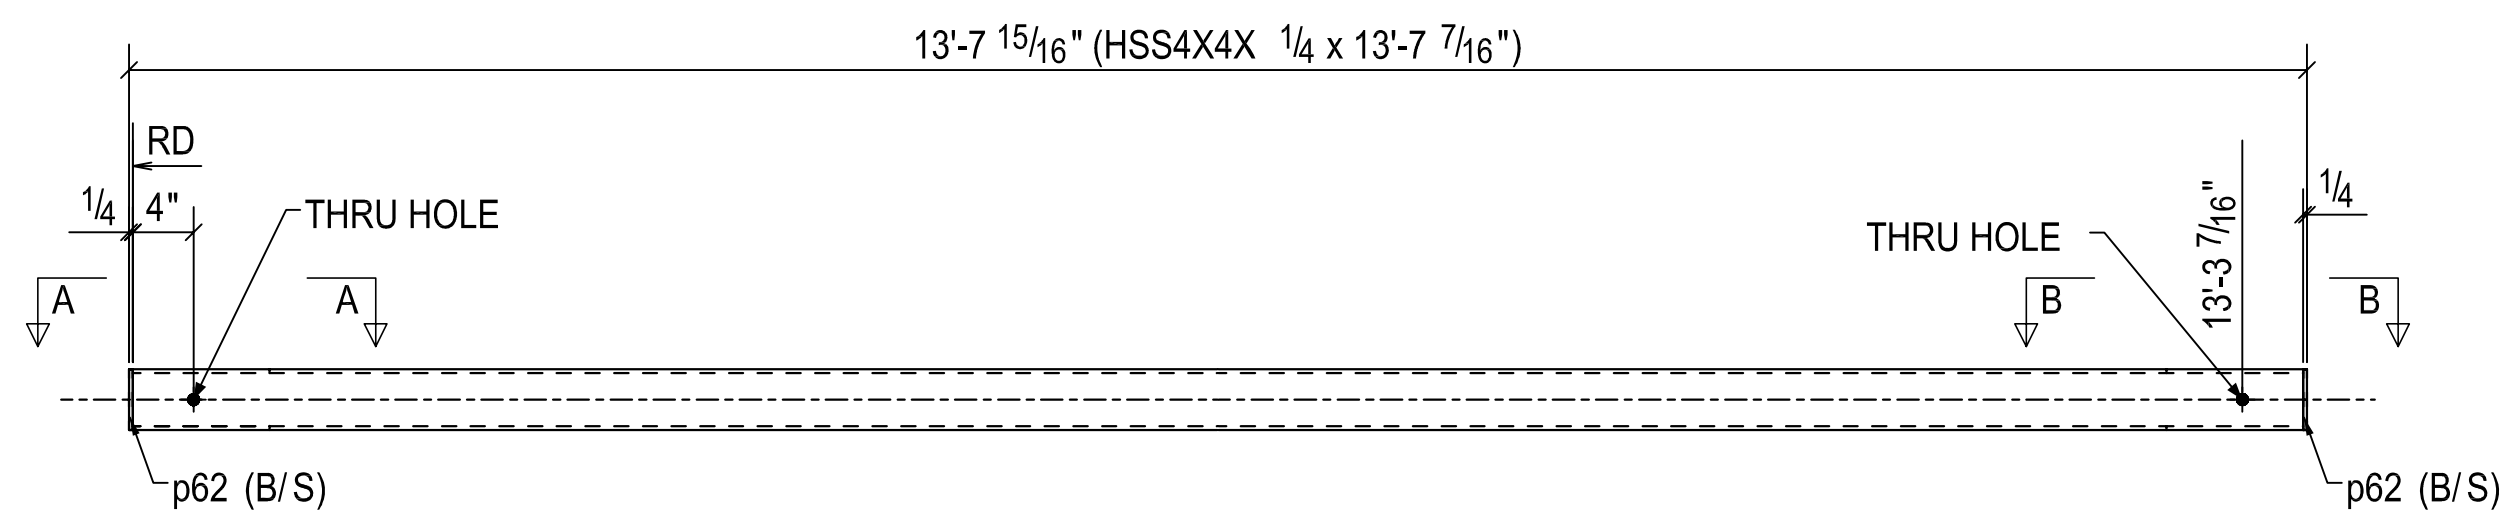


2 - BRACES - 127VR3

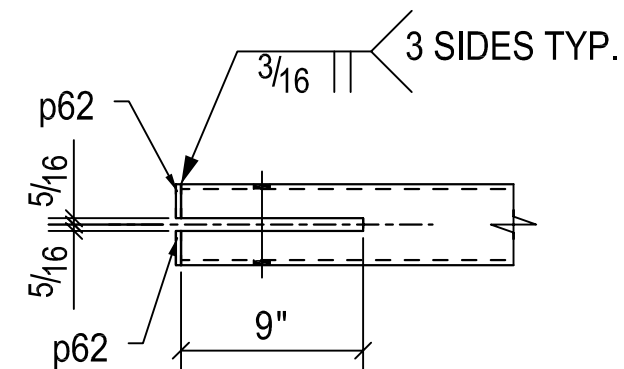


SECTION- A - A

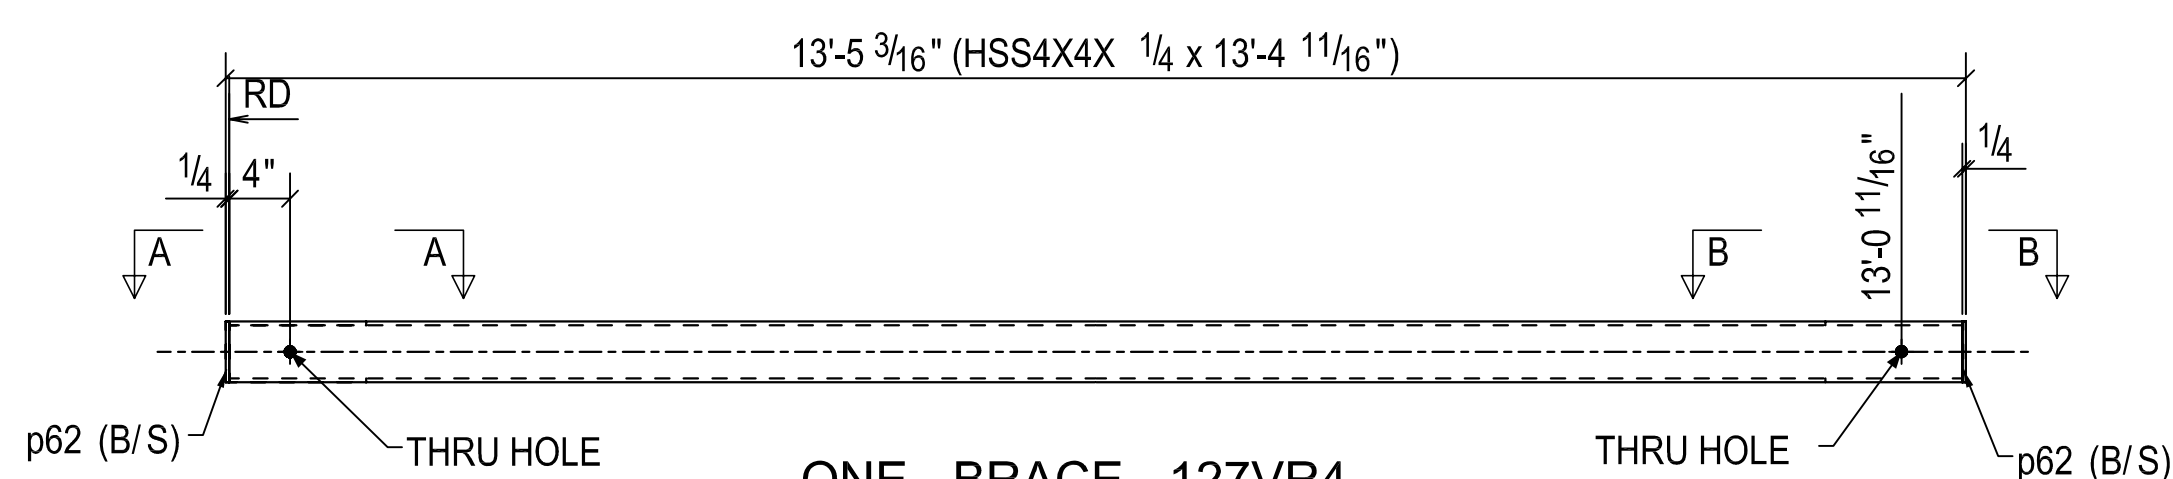


ONE - BRACE - 127VR4

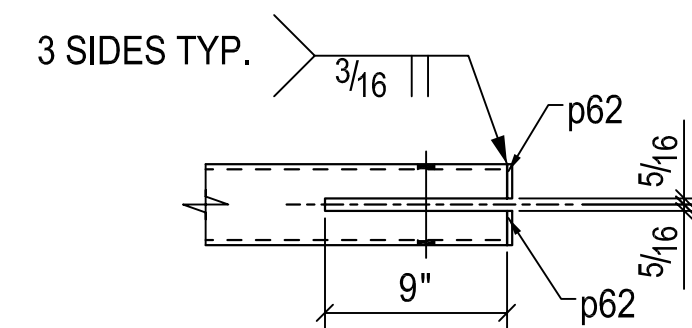


SECTION- B - B

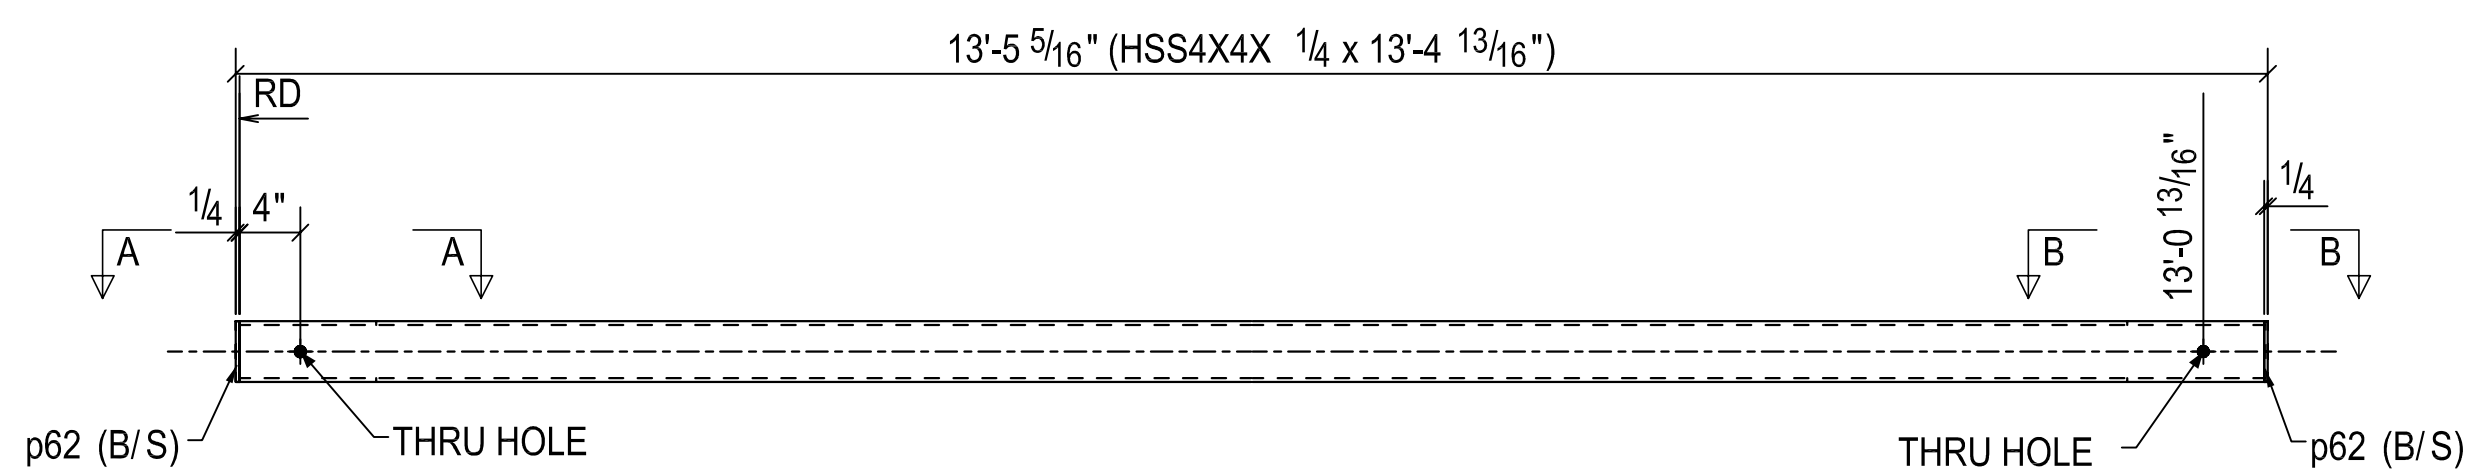

ONE - BRACE - 127VR5

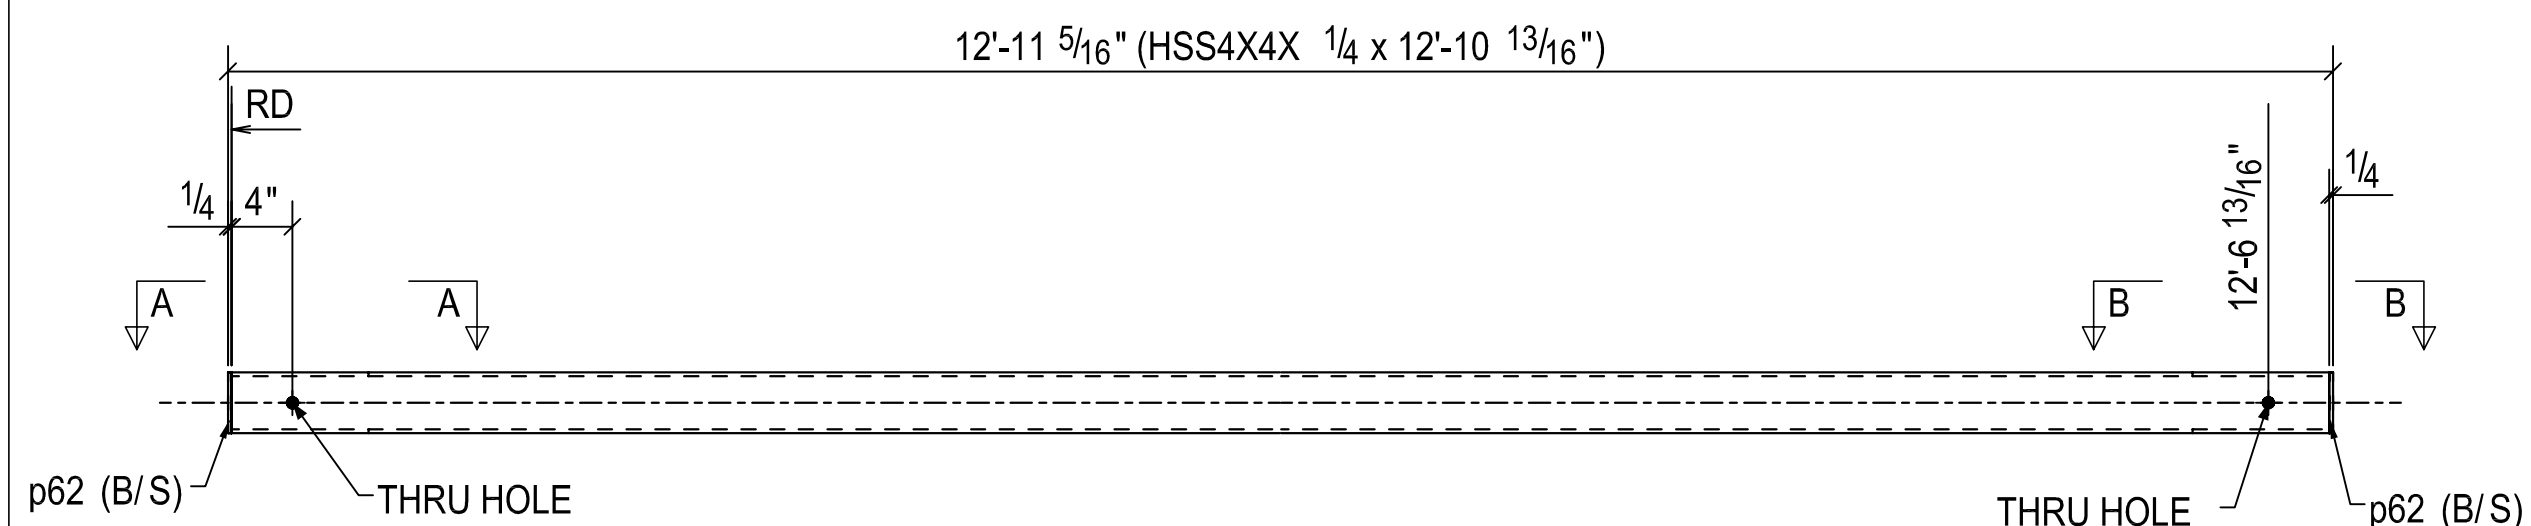

ONE - BRACE - 127VR6

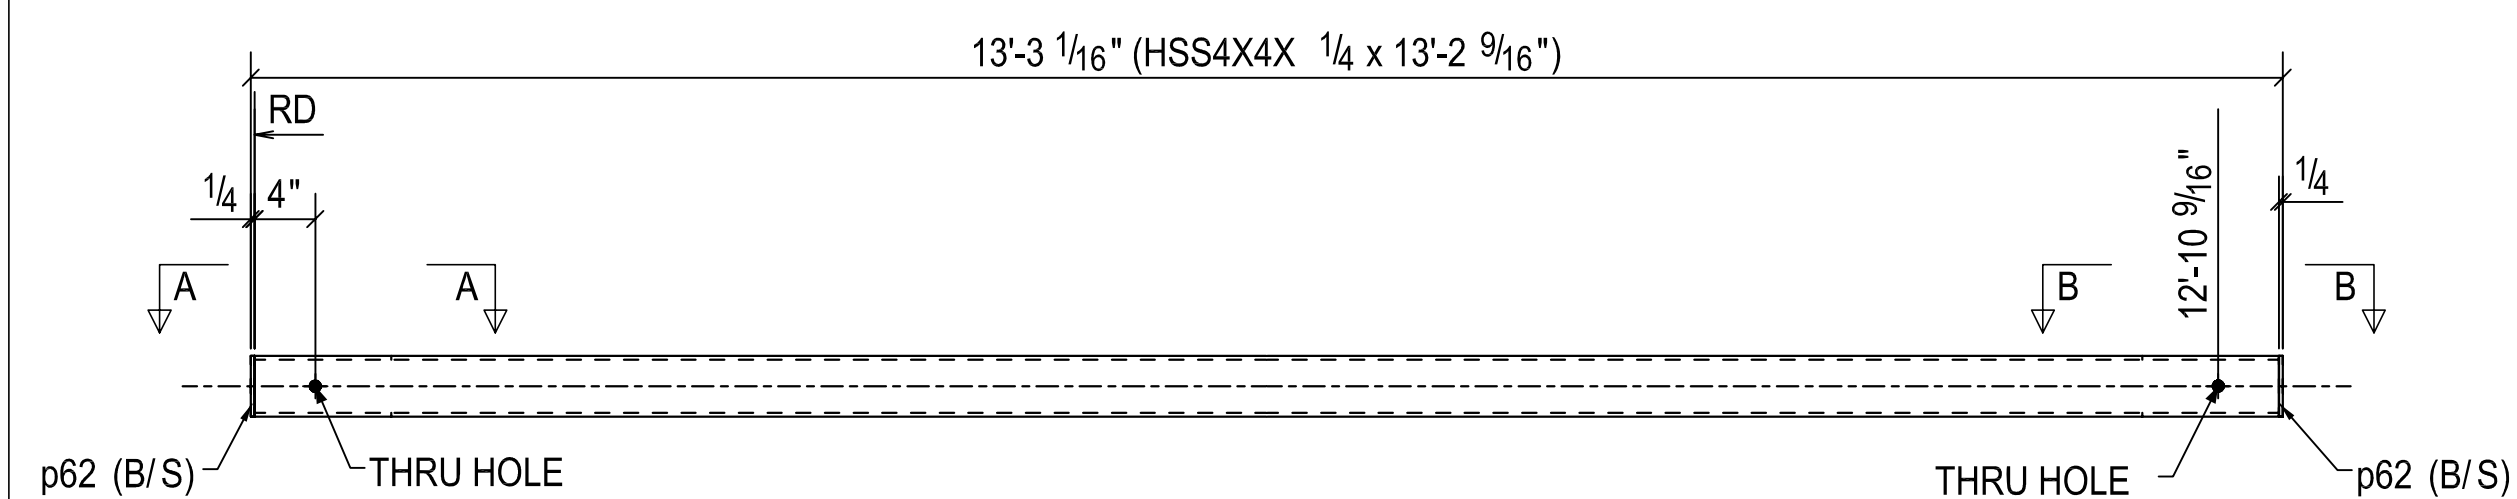

ONE - BRACE - 127VR7

SEQUENCE	SHIPMENT		DESCRIPTION	LENGTH		NOTES	FIN.
	MARK	TEM		QTY	SECTION		
	127VR1		1 BRACE				
		127VR1	1 HSS4X4X1/4		15'-0 7/8"	A500-GR.B	PRIMED
		p62	4 PL1/4"X1 11/16"		0'-4"	A36	
			FIELD BOLTS				
			2 A307 3/4" DIA		0'-5 1/4"	WNUT & WASHER	
	127VR2		1 BRACE				
		127VR2	1 HSS4X4X1/4		15'-0 9/16"	A500-GR.B	PRIMED
		p62	4 PL1/4"X1 11/16"		0'-4"	A36	
			FIELD BOLTS				
			2 A307 3/4" DIA		0'-5 1/4"	WNUT & WASHER	
	127VR3		2 BRACE				
		127VR3	2 HSS4X4X1/4		13'-7 7/16"	A500-GR.B	PRIMED
		p62	8 PL1/4"X1 11/16"		0'-4"	A36	
			FIELD BOLTS				
			4 A307 3/4" DIA		0'-5 1/4"	WNUT & WASHER	
	127VR4		1 BRACE				
		127VR4	1 HSS4X4X1/4		13'-4 11/16"	A500-GR.B	PRIMED
		p62	4 PL1/4"X1 11/16"		0'-4"	A36	
			FIELD BOLTS				
			2 A307 3/4" DIA		0'-5 1/4"	WNUT & WASHER	
	127VR5		1 BRACE				
		127VR5	1 HSS4X4X1/4		13'-4 13/16"	A500-GR.B	PRIMED
		p62	4 PL1/4"X1 11/16"		0'-4"	A36	
			FIELD BOLTS				
			2 A307 3/4" DIA		0'-5 1/4"	WNUT & WASHER	
	127VR6		1 BRACE				
		127VR6	1 HSS4X4X1/4		12'-10 13/16"	A500-GR.B	PRIMED
		p62	4 PL1/4"X1 11/16"		0'-4"	A36	
			FIELD BOLTS				
			2 A307 3/4" DIA		0'-5 1/4"	WNUT & WASHER	
	127VR7		1 BRACE				
		127VR7	1 HSS4X4X1/4		13'-2 9/16"	A500-GR.B	PRIMED
		p62	4 PL1/4"X1 11/16"		0'-4"	A36	
			FIELD BOLTS				
			2 A307 3/4" DIA		0'-5 1/4"	WNUT & WASHER	